

COLORADO CULTURAL RESOURCE SURVEY

Architectural Inventory Form

Page 1 of 3

- Date _____ Initials _____
- _____ Determined Eligible-NR
- _____ Determined Not Eligible-NR
- _____ Determined Eligible-SR
- _____ Determined Not Eligible-SR
- _____ Need Data
- _____ Contributes to Eligible NR District
- _____ Noncontributing to Eligible NR District

I. IDENTIFICATION

1. Resource Number: 5CF2297
2. Temporary Resource Number: 64
3. County: Chaffee
4. City: Salida
5. Historic Building Name: Gallo House
6. Current Building Name: Moore House
7. Building Address: 414 E. Second Street
8. Owner Name and Address: Moore, Marilyn M., 414 E. 2nd St., Salida, CO 81201

Parcel Number: 380705125031
SHF/CLG Grant Number: CO-06-017

II. GEOGRAPHIC INFORMATION

9. P.M. N.M. Township 49N Range 9E
SW 1/4 SE 1/4 NE 1/4 NE 1/4 of Section 5
10. UTM Reference Zone 13 Easting 413864 Northing 4265246
11. USGS Quad Name: Salida East, Colo. Year: 1983 Map Scale: 7.5'
12. Lot (s): 19 and 20 Block(s): 25
Addition: Sackett's Addition Year of Addition: 1898-1904
13. Boundary Description and Justification:
Boundary includes the building and the parcel on which it is located.

III. ARCHITECTURAL DESCRIPTION

14. Building Plan (footprint, shape): Rectangular
15. Dimensions in Feet: Length 60 X Width 30
16. Stories: 1
17. Primary External Wall Material(s) (enter no more than two):
Asbestos
18. Roof Configuration (enter no more than one):
Gabled/Front Gabled
19. Primary External Roof Material (enter no more than one): Asphalt/Composition
20. Special Features (enter all that apply):
Porch, Fence, Chimney
21. General Architectural Description:

One-story, rectangular, front gable roof frame dwelling with overhanging eaves, composition roofing, false beams, and two center brick chimneys. Walls clad with asbestos shingles; raised concrete foundation etched to look like blocks. Front (south) has off-center, projecting, gabled roof porch with asbestos shingle gable face with round ornament with "C" at center. Tapered square column supports atop concrete pedestals, and concrete deck and steps. Center entrance faces porch. Wide double-hung sash windows at each end of façade are 5/1-light double-hung sash with decorative shutters. East wall has a similar window toward the front, a short window at the center, and paired windows toward the rear. West wall has a set of paired windows toward the front and a set of short paired windows toward the rear.

22. **Architectural Style/Building Type:** Late 19th and Early 20th Century American Movements/Craftsman/Bungalow Type

23. **Landscaping or Special Setting Features:**

Level site with grass yard and concrete sidewalks. Gravel and flowers in parking lawn. Large maple tree southeast of house. Planting areas along the edge of the house. Roses in front of the porch. Picket fence encloses backyard.

24. **Associated Buildings, Features, or Objects:**

Shed roof, rectangular, vertical board outbuilding. Front gabled roof, rectangular garage with small cupola at center of roof with weather vane. Composition roofing and slightly overhanging eaves. Garage has drop siding and double, hinged, horizontal board doors facing alley. Two multi-light windows on east and shed roof carport with post supports on west.

IV. ARCHITECTURAL HISTORY

25. **Date of Construction:** Estimate 1924-27 Actual

Source of Information: Chaffee County Assessor

26. **Architect:** Unknown

Source of Information:

27. **Builder/Contractor:** Unknown

Source of Information:

28. **Original Owner:** Unknown

Source of Information:

29. **Construction History (include description and dates of major additions, alterations, or demolitions):**

This parcel is vacant on the 1914 Sanborn fire insurance map and the current house is shown on the 1929 edition. The current Assessor year of construction reported for this house is 1924; the old Assessor appraisal card gave the date of 1922, with a corrected year of 1927 in red. The 1929 and 1945 Sanborn maps depict this house as a one-story rectangular dwelling with a projecting open front porch at the west end of the façade. The old appraisal card and attached 1937 photograph shows a one-story house clad with horizontal wood siding; multi-/single-light double-hung sash windows with wide surrounds, stucco and half-timbering on the gable faces, and the current porch. Sanborn maps indicate that between 1929 and 1945, a rectangular garage was added near the northeast corner of the property.

30. **Original Location:** Yes **Date of Moves:** N/A

V. HISTORICAL ASSOCIATIONS

31. **Original Use(s):** Domestic/Single Dwelling

32. **Intermediate Use(s):** Domestic/Single Dwelling

33. **Current Use(s):** Domestic/Single Dwelling

34. **Site Type(s):** House, Single Family Dwelling

35. **Historical Background:**

This house was erected in 1924 or 1927 according to Chaffee County Assessor records. Phillip and Eleanore M. Gallo were owners of this house in 1930, based on the US Census of that year and an old Assessor's appraisal card. They were married in 1918 and both were born in 1891. A Colorado native, Phillip (b.1891) owned a shoe repair shop at 140 E. 1st. The couple had a son, Bernard (b.1926). Phillip's widowed Italian father, Andrew Gallo, also lived with the couple in 1930. A naturalized citizen, Andrew Gallo (b.1861) first came to the U.S. in 1879. Phillip's mother was also from Italy.

By 1951 Elbridge L. "Sam" and Eula Samson lived at this address. Sam was a cashier at the Rio Grande Freight House. In 1930 Elbridge and his previous wife, Adersa, had lived at a different address in Salida, and he had been employed as a car checker with the railroad. Elbridge was born in Colorado in 1898. In 1965 Philip F. and Ruth Scott were the owners and residents of this house. No occupations were listed for the Scotts in the city directory.

36. **Sources of Information:**

Mountain Mail: 15 August 1966, 1; Salida City Directories; Sanborn Insurance Maps; Chaffee County Assessor records; US Census records, 1900-1930.

VI. SIGNIFICANCE

37. Local Landmark Designation: No Date of Designation: N/A
Designating Authority: N/A
Local Landmark Eligibility: No
Local Landmark Criteria: 1 - Exemplary Property 3 - Architectural Signif. 5 - Archeological Imp.
2 - Historic Signif. 4 - Noted Designer: 6 - Contributing Bldg.

38. Applicable National Register Criteria:

- A. Associated with events that have made a significant contribution to the broad pattern of our history;
- B. Associated with the lives of persons significant in our past;
- C. Embodies the distinctive characteristics of a type, period, or method of construction, or represents the work of a master, or that possesses high artistic values, or represents a significant and distinguishable entity whose components may lack individual distinction; or
- D. Has yielded, or may be likely to yield, information important to history or prehistory.

Qualifies under Criteria Considerations A through G (See Manual).

X Does not meet any of the above National Register criteria.

39. Area(s) of Significance: N/A

40. Period of Significance: N/A

41. Level of Significance: N/A

42. Statement of Significance:

This house, erected in 1924, represents Arts & Crafts architectural features in a Bungalow type dwelling through its gabled roof and overlapping gabled porch with square tapered columns atop concrete pedestals and its multi-/single-light double-hung sash windows.

43. Assessment of Historic Physical Integrity Related to Significance:

This house maintains historic physical integrity despite alterations that include the application of cement asbestos shingles to walls and gable faces.

VII. NATIONAL REGISTER ELIGIBILITY ASSESSMENT

44. National Register Field Eligibility Assessment: Not eligible

45. Is there National Register district potential? Discuss. Yes

This resource was documented as part of a survey of a portion of northeast Salida lying between Downtown and the historic Denver & Rio Grande Railroad Hospital. A previous reconnaissance of this neighborhood of the city resulted in the recommendation that this area be intensively surveyed to determine whether a historic district might exist. The boundaries of such a district have not yet been identified since some areas included in the current survey might logically be associated with adjacent unsurveyed areas. A preliminary evaluation of whether this property would be a contributing resource, if found to be within the boundaries of a district, has been made to assist future studies.

If there is NRHP district potential, indicate contributing status: Contributing

46. If the building is in an existing NRHP district, indicate contributing status: N/A

VIII. RECORDING INFORMATION

47. Photographic Reference(s): 8: 28-33; 21: 1-2

Negatives Filed At: City of Salida

Photographer: T.H. Simmons

48. Report Title: Salida, Colorado, Historic Buildings Survey, 2006-07

49. Date(s): June 2006

50. Recorder(s): R.L. Simmons/T.H. Simmons

51. Organization: Front Range Research Associates, Inc.

52. Address: 3635 W. 46th Ave., Denver, CO 80211

53. Phone Number(s): (303) 477-7597

NOTE: Please attach a sketch map, a photocopy of the USGS quad map indicating the resource's location, and photographs.




SOURCE: Building outlines from CAD file provided by City of Salida (and supplemented by fieldwork) and overlaid on parcels produced by Chaffee County. The resource described by this survey form is darkly shaded.



414 E. Second Street



LEGEND	
	Survey Area Boundary
	Surveyed-Primary Buildings
	Surveyed-Outbuildings
	Not Surveyed

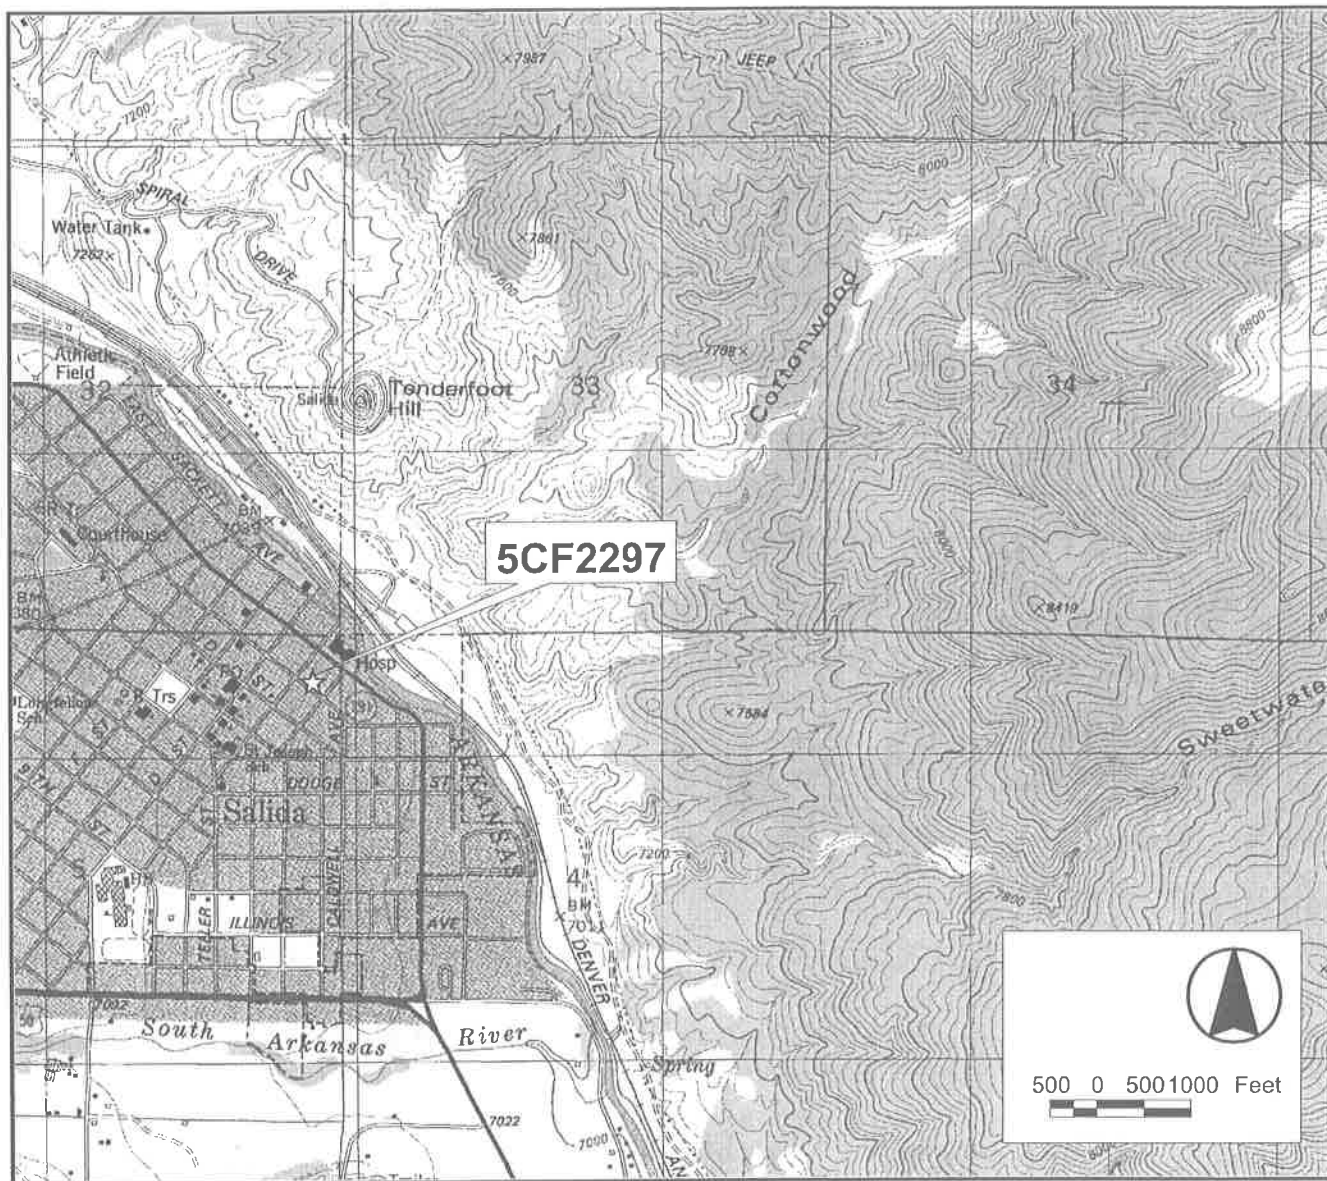

SOURCE: Extract of U.S. Geological Survey, "Salida East, Colo.," 7.5 minute quadrangle map (Denver: U.S. Geological Survey, 1994).

414 E. Second Street

